Visual Brake Stroke Indicator

- Provides an easy, visual means of conducting mandatory pre-trip air brake inspection in minutes
- Drivers, mechanics or inspectors view indicators in 10 percent of the time, without going under truck/trailer
- Saves fleets, drivers and owner-operators time and money and protects against heavy fines and lost points
- Reduces risk of accidents, conveys fleet commitment to safety and may reduce accident insurance cost
- Reduces equipment downtime due to inspection or needless air brake adjustment
- Automatic slack adjusters also require pre-trip inspection
- Heavy duty plated bracket - bolts easily on to the truck/trailer brake chamber
- Pre-measured reference unit with bright yellow “goalpost”
- Tooled clevis pin with bright red “pointer” replaces clevis pin linking slack adjuster to push rod
- As long as the pointer is positioned between the centers of the two goalposts, the brakes are properly adjusted

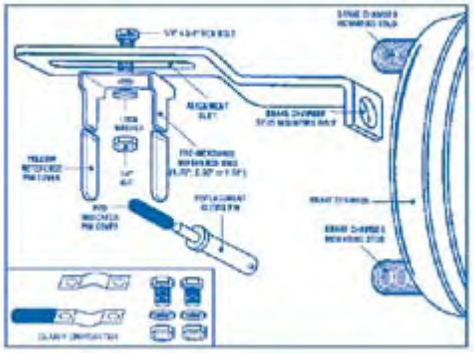

1/2” Clevis Pin standard on all units.
* Units ending in CP do not have Clevis Pin

Universal Truck (Power Unit) Brackets:

Tectran Part No.	Stk. Code	Brake Safe Part No.	Chamber Type	Reference Unit Width	Typical Applications
BR01	63111	PU242	16, 20, 24	1.75”	Most steering axles
BR02	63024	PU302	30, 16L, 20L, 24L	2.00”	Most drive axles & long stokes
BR04	63113	PU250LS	24LS, 30LS sq. port	2.50”	Long-stroke, square port chambers
BR24	63036	PU242CP	16, 20, 24 extd. bracket	1.75”	Clamp-on pointer for long push rods
BR21	63033	PU302CP	30-extd bracket	2.00”	Clamp-on pointer for long push rods
BR25	63037	PU250LSCP	24LS, 30LS sq. port	2.50”	Clamp-on pointer for long push rods

1/2” Clevis Pin standard on all units.
* Units ending in CP do not have Clevis Pin

Universal Trailer Brackets:

Tectran Part No.	Stk.Code	Brake Safe Part No.	Chamber Type	Reference Unit Width	Typical Applications
BR05	63114	TL302	30	2.00”	Flatbed, Van & Tanker trailers
BR06	63025	TL250LS	30LS sq. port	2.50”	Long-stroke, square port chambers
BR07	63026	TL302S	30-short bracket	2.00”	Low-float trailers, short bracket
BR20	63030	TL302CP	30	2.00”	Intraax Axles, Clamp-on pointer
BR23	63035	TL250LSCP	30LS sq. port	2.50”	Intraax Axles, Clamp-on pointer

Replacement Parts:

Tectran Part No.	Stk. Code	Description
BR19	63029	½” Clevis Pin
BR08	63115	⅝” Clevis Pin
BR175	63027	Hardware Kit - 1.75” indicator, covers, ½” clevis pin and bolts
BR200	63031	Hardware Kit - 2.00” indicator, covers, ½” clevis pin and bolts
BR250	63038	Hardware Kit - 2.50” indicator, covers, ½” clevis pin and bolts
BR2R	63124	Red clevis pin covers
BR2Y	63125	Yellow indicator pin covers
BR175CP	63028	Hardware Kit - 1.75” indicator, clamp-on pointer
BR200CP	63032	Hardware Kit - 2.00” indicator, clamp-on pointer
BR250CP	63039	Hardware Kit - 2.50” indicator, clamp-on pointer

*BrakeSafe™ is a registered trademark of Spectra Inc.